


## JT22053 Repair Kit - X480295

This Repair Kit was created in order to aid the service technician in acquisition of the proper convergence or focus repair parts. Included are the six low ohm/high wattage return resistors as well as both convergence yokes. Generally speaking, this kit is to be used when a single color has lost either horizontal or vertical control. It is highly recommended to replace all of these parts together, especially the two STKs. If the convergence problem remains after replacing the output section, the service technician should be advised to ensure that both the DCU and the Convergence Yokes are functioning properly.

### Convergence/Focus PWB — DP15 Chassis

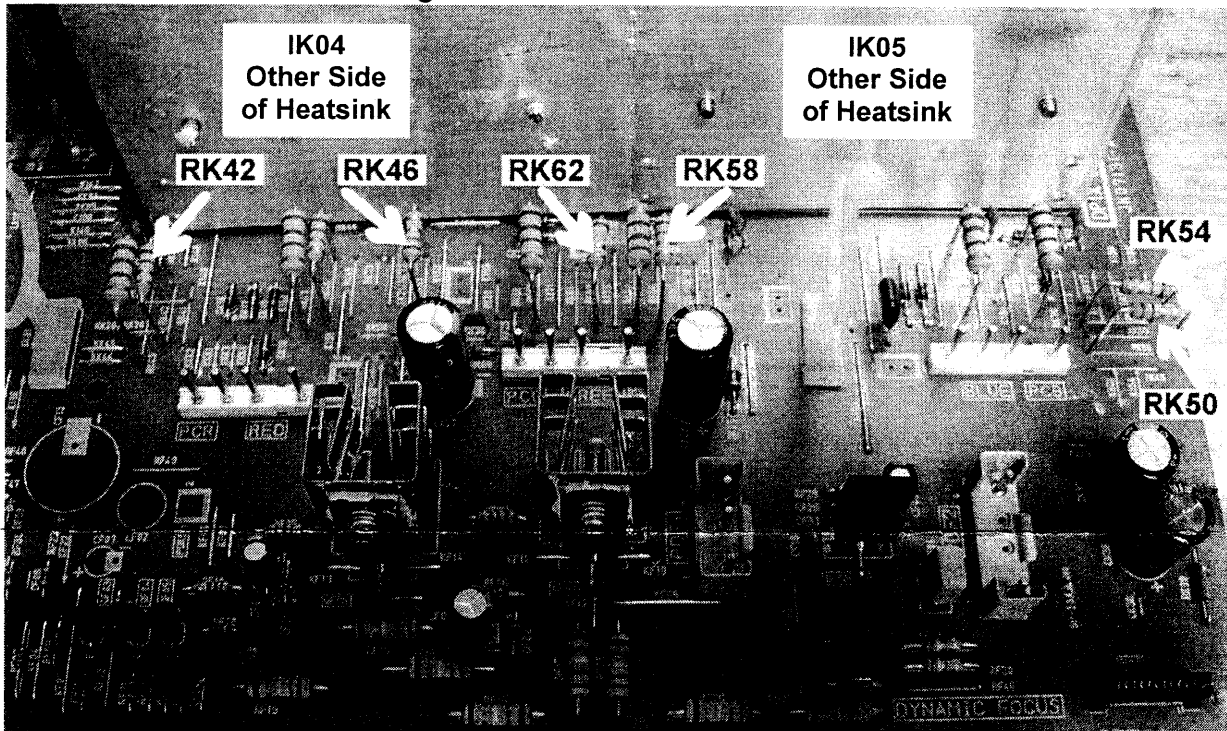

### Contents of JT22053 Repair Kit - p/n X480295

CHASSIS DP15		
RELATED MODELS		
53UDX10B, 61UDX10B		
Component Location	Value	Part #
RK42	3.3 $\Omega$ 1W	AT03202S
RK46	1.8 $\Omega$ 1W	AT03195S
RK50	3.3 $\Omega$ 1W	AT03202S
RK54	1.8 $\Omega$ 1W	AT03195S
RK58	3.9 $\Omega$ 1W	AT03204S
RK62	2.2 $\Omega$ 1W	AT03197S
IK04 & IK05	STK392-150	CZ00433

For further assistance, please visit <http://www.hitachiserviceusa.com>